
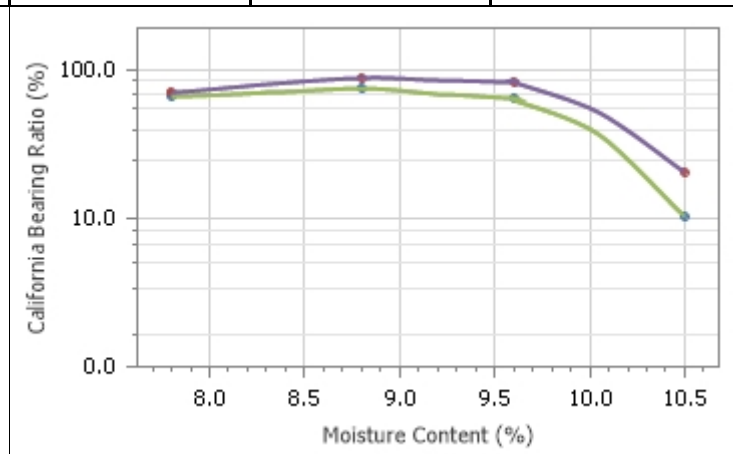


CALIFORNIA BEARING RATIO REPORT

Client: Glendon Quarry Pty Ltd	Report Number: 1692/R/9927-1
Client Address: PO Box 771, Glendon Road , Anakie	Project Number: 1692/P/318
Project: Glendon Quarry Compliance Testing	Lot Number:
Location: Glendon Road Rubyvale	Internal Test Request: 1692/T/3775
Component:	Client Reference/s: 17/01/18
Area Description:	Report Date / Page: 22/01/2018 Page 1 of 1

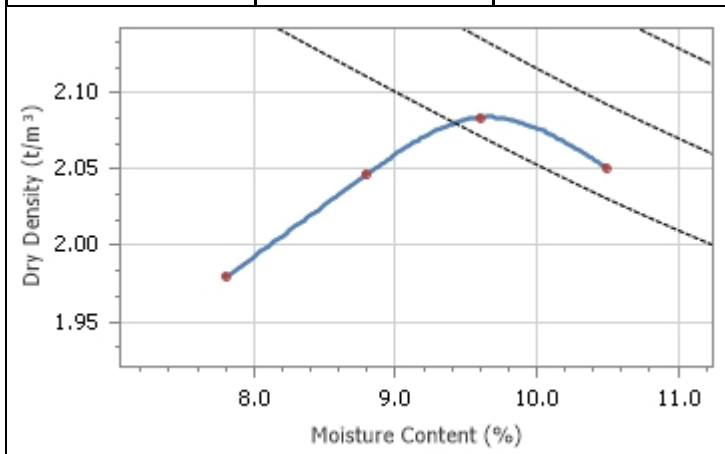

Test Procedures: Q113A, Q102A	Stockpile Lot No T2.3 RB
Sample Number 1692/S/21774	Sample No Sample 1
Sampling Method Tested As Received	-
Date Sampled 17/01/2018	-
Sample Depth -	Material Source Glendon Quarry
Date Tested 18/01/2018	Material Type Subtype 2.3
Test Condition Soaked / 4 Days	Compactive Effort Standard

Placement Moisture Content (%)	Placement Dry Density (t/m ³)	Point Bearing Ratio @ 2.5mm	Point Bearing Ratio @ 5.0mm	CBR Swell (%)	Moisture Content After Penetration (%)
7.8	1.98	66.3	70.4	0.0	-
8.8	2.05	76.0	89.5	-0.7	-
9.6	2.08	64.5	83.3	-0.6	-
10.5	2.05	10.2	20.6	-0.5	-



CBR MDD (t/m ³) 2.08	CBR 2.5mm 60	CALIFORNIA BEARING RATIO
CBR OMC (%) 9.5	CBR 5.0mm 80	80
Soil Description Grey Gravel		

Remarks

	<p style="text-align: center;">The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards. Accredited for compliance with ISO/IEC 17025 - Testing</p> <p>Accreditation Number: 1986 Corporate Site Number: 1692</p>	 Approved Signatory: Donna Marr Form ID: W8Rep Rev 2
--	--	---